

SAFETY DATA SHEET

Arsine, adsorbed

Section 1. Identification

GHS product identifier	: Arsine, adsorbed
Chemical name	: Arsine, adsorbed
Other means of identification	: Hydrogen arsenide; Arsenous hydride; Arseniuretted hydrogen; Arsenic trihydride; Arsenic hydride
Product use	: Synthetic/Analytical chemistry.
Synonym	: Hydrogen arsenide; Arsenous hydride; Arseniuretted hydrogen; Arsenic trihydride; Arsenic hydride
SDS #	: 001217
Supplier's details	: Airgas USA, LLC and its affiliates 259 North Radnor-Chester Road Suite 100 Radnor, PA 19087-5283 1-610-687-5253
24-hour telephone	: 1-866-734-3438

Section 2. Hazards identification

OSHA/HCS status	: This material is considered hazardous by the OSHA Hazard Communication Standard (29 CFR 1910.1200).
Classification of the substance or mixture	: FLAMMABLE GASES - Category 1 GASES UNDER PRESSURE - Compressed gas ACUTE TOXICITY (inhalation) - Category 1 CARCINOGENICITY - Category 1A SPECIFIC TARGET ORGAN TOXICITY (SINGLE EXPOSURE) - Category 1 SPECIFIC TARGET ORGAN TOXICITY (REPEATED EXPOSURE) - Category 1 AQUATIC HAZARD (ACUTE) - Category 1 AQUATIC HAZARD (LONG-TERM) - Category 1

GHS label elements

Hazard pictograms



Signal word

: Danger

Hazard statements

: Extremely flammable gas.
Contains gas under pressure; may explode if heated.
May form explosive mixtures in Air.
Fatal if inhaled.
May cause cancer.
Causes damage to organs.
Causes damage to organs through prolonged or repeated exposure.
Very toxic to aquatic life with long lasting effects.

Precautionary statements

General

: Read and follow all Safety Data Sheets (SDS'S) before use. Read label before use. Keep out of reach of children. If medical advice is needed, have product container or label at hand. Close valve after each use and when empty. Use equipment rated for cylinder pressure. Do not open valve until connected to equipment prepared for use. Use a back flow preventative device in the piping. Use only equipment of compatible materials of construction. Approach suspected leak area with caution.

Section 2. Hazards identification

- Prevention** : Obtain special instructions before use. Do not handle until all safety precautions have been read and understood. Wear protective gloves. Wear eye or face protection. Wear protective clothing. Wear respiratory protection. Keep away from heat, hot surfaces, sparks, open flames and other ignition sources. No smoking. Use only outdoors or in a well-ventilated area. Avoid release to the environment. Do not breathe gas. Do not eat, drink or smoke when using this product. Wash hands thoroughly after handling.
- Response** : Collect spillage. Get medical attention if you feel unwell. IF exposed: Call a POISON CENTER or physician. IF INHALED: Remove person to fresh air and keep comfortable for breathing. Immediately call a POISON CENTER or physician. Leaking gas fire: Do not extinguish, unless leak can be stopped safely. Eliminate all ignition sources if safe to do so.
- Storage** : Store locked up. Protect from sunlight when ambient temperature exceeds 52°C/125°F. Store in a well-ventilated place.
- Disposal** : Dispose of contents and container in accordance with all local, regional, national and international regulations.
- Hazards not otherwise classified** : In addition to any other important health or physical hazards, this product may displace oxygen and cause rapid suffocation.

Section 3. Composition/information on ingredients

- Substance/mixture** : Substance
- Chemical name** : Arsine, absorbed
- Other means of identification** : Hydrogen arsenide; Arsenous hydride; Arseniuretted hydrogen; Arsenic trihydride; Arsenic hydride

CAS number/other identifiers

- CAS number** : 7784-42-1
- Product code** : 001217

Ingredient name	%	CAS number
Arsine, absorbed	100	7784-42-1

Any concentration shown as a range is to protect confidentiality or is due to batch variation.

There are no additional ingredients present which, within the current knowledge of the supplier and in the concentrations applicable, are classified as hazardous to health or the environment and hence require reporting in this section.

Occupational exposure limits, if available, are listed in Section 8.

Section 4. First aid measures

Description of necessary first aid measures

- Eye contact** : Immediately flush eyes with plenty of water, occasionally lifting the upper and lower eyelids. Check for and remove any contact lenses. Continue to rinse for at least 10 minutes. Get medical attention. If necessary, call a poison center or physician.
- Inhalation** : Get medical attention immediately. Call a poison center or physician. Remove victim to fresh air and keep at rest in a position comfortable for breathing. If it is suspected that fumes are still present, the rescuer should wear an appropriate mask or self-contained breathing apparatus. If not breathing, if breathing is irregular or if respiratory arrest occurs, provide artificial respiration or oxygen by trained personnel. It may be dangerous to the person providing aid to give mouth-to-mouth resuscitation. If unconscious, place in recovery position and get medical attention immediately. Maintain an open airway. Loosen tight clothing such as a collar, tie, belt or waistband.
- Skin contact** : Flush contaminated skin with plenty of water. Remove contaminated clothing and shoes. To avoid the risk of static discharges and gas ignition, soak contaminated clothing thoroughly with water before removing it. Continue to rinse for at least 10 minutes. Get medical attention. If necessary, call a poison center or physician. Wash clothing before reuse. Clean shoes thoroughly before reuse.
- Ingestion** : As this product is a gas, refer to the inhalation section.

Section 4. First aid measures

Most important symptoms/effects, acute and delayed

Potential acute health effects

- Eye contact** : Contact with rapidly expanding gas may cause burns or frostbite.
- Inhalation** : Fatal if inhaled.
- Skin contact** : Contact with rapidly expanding gas may cause burns or frostbite.
- Frostbite** : Try to warm up the frozen tissues and seek medical attention.
- Ingestion** : As this product is a gas, refer to the inhalation section.

Over-exposure signs/symptoms

- Eye contact** : No specific data.
- Inhalation** : No specific data.
- Skin contact** : No specific data.
- Ingestion** : No specific data.

Indication of immediate medical attention and special treatment needed, if necessary

- Notes to physician** : Treat symptomatically. Contact poison treatment specialist immediately if large quantities have been ingested or inhaled.
- Specific treatments** : No specific treatment.
- Protection of first-aiders** : No action shall be taken involving any personal risk or without suitable training. If it is suspected that fumes are still present, the rescuer should wear an appropriate mask or self-contained breathing apparatus. It may be dangerous to the person providing aid to give mouth-to-mouth resuscitation. Wash contaminated clothing thoroughly with water before removing it, or wear gloves.

See toxicological information (Section 11)

Section 5. Fire-fighting measures

Extinguishing media

- Suitable extinguishing media** : Use an extinguishing agent suitable for the surrounding fire.
- Unsuitable extinguishing media** : None known.

- Specific hazards arising from the chemical** : Contains gas under pressure. Extremely flammable gas. In a fire or if heated, a pressure increase will occur and the container may burst, with the risk of a subsequent explosion. The vapor/gas is heavier than air and will spread along the ground. Gas may accumulate in low or confined areas or travel a considerable distance to a source of ignition and flash back, causing fire or explosion. This material is very toxic to aquatic life with long lasting effects. Fire water contaminated with this material must be contained and prevented from being discharged to any waterway, sewer or drain.

- Hazardous thermal decomposition products** : Decomposition products may include the following materials:
metal oxide/oxides

- Special protective actions for fire-fighters** : Promptly isolate the scene by removing all persons from the vicinity of the incident if there is a fire. No action shall be taken involving any personal risk or without suitable training. Contact supplier immediately for specialist advice. Move containers from fire area if this can be done without risk. Use water spray to keep fire-exposed containers cool. If involved in fire, shut off flow immediately if it can be done without risk. If this is impossible, withdraw from area and allow fire to burn. Fight fire from protected location or maximum possible distance. Eliminate all ignition sources if safe to do so.

- Special protective equipment for fire-fighters** : Fire-fighters should wear appropriate protective equipment and self-contained breathing apparatus (SCBA) with a full face-piece operated in positive pressure mode.

Section 6. Accidental release measures

Personal precautions, protective equipment and emergency procedures

- For non-emergency personnel** : Accidental releases pose a serious fire or explosion hazard. No action shall be taken involving any personal risk or without suitable training. Evacuate surrounding areas. Keep unnecessary and unprotected personnel from entering. Shut off all ignition sources. No flares, smoking or flames in hazard area. Do not breathe gas. Provide adequate ventilation. Wear appropriate respirator when ventilation is inadequate. Put on appropriate personal protective equipment.
- For emergency responders** : If specialised clothing is required to deal with the spillage, take note of any information in Section 8 on suitable and unsuitable materials. See also the information in "For non-emergency personnel".

- Environmental precautions** : Ensure emergency procedures to deal with accidental gas releases are in place to avoid contamination of the environment. Inform the relevant authorities if the product has caused environmental pollution (sewers, waterways, soil or air). Water polluting material. May be harmful to the environment if released in large quantities. Collect spillage.

Methods and materials for containment and cleaning up

- Small spill** : Immediately contact emergency personnel. Stop leak if without risk. Use spark-proof tools and explosion-proof equipment.
- Large spill** : Immediately contact emergency personnel. Stop leak if without risk. Use spark-proof tools and explosion-proof equipment. Note: see Section 1 for emergency contact information and Section 13 for waste disposal.

Section 7. Handling and storage

Precautions for safe handling

- Protective measures** : Put on appropriate personal protective equipment (see Section 8). Contains gas under pressure. Avoid exposure - obtain special instructions before use. Do not handle until all safety precautions have been read and understood. Do not get in eyes or on skin or clothing. Do not breathe gas. Avoid release to the environment. Use only with adequate ventilation. Wear appropriate respirator when ventilation is inadequate. Do not enter storage areas and confined spaces unless adequately ventilated. Store and use away from heat, sparks, open flame or any other ignition source. Use explosion-proof electrical (ventilating, lighting and material handling) equipment. Use only non-sparking tools. Empty containers retain product residue and can be hazardous. Do not puncture or incinerate container. Use equipment rated for cylinder pressure. Close valve after each use and when empty. Protect cylinders from physical damage; do not drag, roll, slide, or drop. Use a suitable hand truck for cylinder movement.

- Advice on general occupational hygiene** : Eating, drinking and smoking should be prohibited in areas where this material is handled, stored and processed. Workers should wash hands and face before eating, drinking and smoking. Remove contaminated clothing and protective equipment before entering eating areas. See also Section 8 for additional information on hygiene measures.

- Conditions for safe storage, including any incompatibilities** : Store in accordance with local regulations. Store in a segregated and approved area. Store away from direct sunlight in a dry, cool and well-ventilated area, away from incompatible materials (see Section 10). Store locked up. Eliminate all ignition sources. Keep container tightly closed and sealed until ready for use. Cylinders should be stored upright, with valve protection cap in place, and firmly secured to prevent falling or being knocked over. Cylinder temperatures should not exceed 52 °C (125 °F).

Section 8. Exposure controls/personal protection

Control parameters

Occupational exposure limits

Ingredient name	Exposure limits
Arsine, absorbed	<p>ACGIH TLV (United States, 3/2016). TWA: 0.005 ppm 8 hours.</p> <p>NIOSH REL (United States, 10/2013). CEIL: 0.002 mg/m³ 15 minutes.</p> <p>OSHA PEL (United States, 6/2016). TWA: 0.2 mg/m³ 8 hours. TWA: 0.05 ppm 8 hours.</p> <p>OSHA PEL 1989 (United States, 3/1989). TWA: 0.2 mg/m³ 8 hours. TWA: 0.05 ppm 8 hours.</p>

Appropriate engineering controls : Use only with adequate ventilation. Use process enclosures, local exhaust ventilation or other engineering controls to keep worker exposure to airborne contaminants below any recommended or statutory limits. The engineering controls also need to keep gas, vapor or dust concentrations below any lower explosive limits. Use explosion-proof ventilation equipment.

Environmental exposure controls : Emissions from ventilation or work process equipment should be checked to ensure they comply with the requirements of environmental protection legislation. In some cases, fume scrubbers, filters or engineering modifications to the process equipment will be necessary to reduce emissions to acceptable levels.

Individual protection measures

Hygiene measures : Wash hands, forearms and face thoroughly after handling chemical products, before eating, smoking and using the lavatory and at the end of the working period. Appropriate techniques should be used to remove potentially contaminated clothing. Wash contaminated clothing before reusing. Ensure that eyewash stations and safety showers are close to the workstation location.

Eye/face protection : Safety eyewear complying with an approved standard should be used when a risk assessment indicates this is necessary to avoid exposure to liquid splashes, mists, gases or dusts. If contact is possible, the following protection should be worn, unless the assessment indicates a higher degree of protection: safety glasses with side-shields.

Skin protection

Hand protection : Chemical-resistant, impervious gloves complying with an approved standard should be worn at all times when handling chemical products if a risk assessment indicates this is necessary. Considering the parameters specified by the glove manufacturer, check during use that the gloves are still retaining their protective properties. It should be noted that the time to breakthrough for any glove material may be different for different glove manufacturers. In the case of mixtures, consisting of several substances, the protection time of the gloves cannot be accurately estimated.

Body protection : Personal protective equipment for the body should be selected based on the task being performed and the risks involved and should be approved by a specialist before handling this product. When there is a risk of ignition from static electricity, wear anti-static protective clothing. For the greatest protection from static discharges, clothing should include anti-static overalls, boots and gloves.

Other skin protection : Appropriate footwear and any additional skin protection measures should be selected based on the task being performed and the risks involved and should be approved by a specialist before handling this product.

Respiratory protection : Use a properly fitted, air-purifying or air-fed respirator complying with an approved standard if a risk assessment indicates this is necessary. Respirator selection must be based on known or anticipated exposure levels, the hazards of the product and the safe working limits of the selected respirator.

Section 9. Physical and chemical properties

Appearance

Physical state	: Gas. [Compressed gas.]
Color	: Colorless.
Molecular weight	: 77.95 g/mole
Molecular formula	: As-H ₃
Boiling/condensation point	: -62°C (-79.6°F)
Melting/freezing point	: -117°C (-178.6°F)
Critical temperature	: 99.9°C (211.8°F)
Odor	: Characteristic.
Odor threshold	: Not available.
pH	: Not available.
Flash point	: Not available.
Burning time	: Not applicable.
Burning rate	: Not applicable.
Evaporation rate	: Not available.
Flammability (solid, gas)	: Not available.
Lower and upper explosive (flammable) limits	: Lower: 4.5% Upper: 78%
Vapor pressure	: 205 (psig)
Vapor density	: 2.7 (Air = 1)
Specific Volume (ft³/lb)	: 4.9383
Gas Density (lb/ft³)	: 0.2025 (20°C / 68 to °F)
Relative density	: Not applicable.
Solubility	: Not available.
Solubility in water	: Not available.
Partition coefficient: n-octanol/water	: Not available.
Auto-ignition temperature	: Not available.
Decomposition temperature	: Not available.
SADT	: Not available.
Viscosity	: Not applicable.

Section 10. Stability and reactivity

Reactivity	: No specific test data related to reactivity available for this product or its ingredients.
Chemical stability	: The product is stable.
Possibility of hazardous reactions	: Under normal conditions of storage and use, hazardous reactions will not occur.
Conditions to avoid	: Avoid all possible sources of ignition (spark or flame). Do not pressurize, cut, weld, braze, solder, drill, grind or expose containers to heat or sources of ignition. Do not allow gas to accumulate in low or confined areas.
Incompatible materials	: Oxidizers
Hazardous decomposition products	: Under normal conditions of storage and use, hazardous decomposition products should not be produced.

Section 10. Stability and reactivity

Hazardous polymerization : Under normal conditions of storage and use, hazardous polymerization will not occur.

Section 11. Toxicological information

Information on toxicological effects

Acute toxicity

Product/ingredient name	Result	Species	Dose	Exposure
Arsine, absorbed	LC50 Inhalation Gas.	Rat	178 ppm	1 hours

IDLH : 3 ppm

Irritation/Corrosion

Not available.

Sensitization

Not available.

Mutagenicity

Not available.

Carcinogenicity

Not available.

Classification

Product/ingredient name	OSHA	IARC	NTP
Arsine, absorbed	-	1	Known to be a human carcinogen.

Reproductive toxicity

Not available.

Teratogenicity

Not available.

Specific target organ toxicity (single exposure)

Name	Category	Route of exposure	Target organs
Arsine, absorbed	Category 1	Not determined	Not determined

Specific target organ toxicity (repeated exposure)

Name	Category	Route of exposure	Target organs
Arsine, absorbed	Category 1	Not determined	Not determined

Aspiration hazard

Not available.

Information on the likely routes of exposure : Not available.

Potential acute health effects

Eye contact : Contact with rapidly expanding gas may cause burns or frostbite.

Inhalation : Fatal if inhaled.

Skin contact : Contact with rapidly expanding gas may cause burns or frostbite.

Ingestion : As this product is a gas, refer to the inhalation section.

Symptoms related to the physical, chemical and toxicological characteristics

Eye contact : No specific data.

Section 11. Toxicological information

- Inhalation** : No specific data.
Skin contact : No specific data.
Ingestion : No specific data.

Delayed and immediate effects and also chronic effects from short and long term exposure

Short term exposure

- Potential immediate effects** : Not available.
Potential delayed effects : Not available.

Long term exposure

- Potential immediate effects** : Not available.
Potential delayed effects : Not available.

Potential chronic health effects

Not available.

- General** : Causes damage to organs through prolonged or repeated exposure.
Carcinogenicity : May cause cancer. Risk of cancer depends on duration and level of exposure.
Mutagenicity : No known significant effects or critical hazards.
Teratogenicity : No known significant effects or critical hazards.
Developmental effects : No known significant effects or critical hazards.
Fertility effects : No known significant effects or critical hazards.

Numerical measures of toxicity

Acute toxicity estimates

Not available.

Section 12. Ecological information

Toxicity

Not available.

Persistence and degradability

Not available.

Bioaccumulative potential

Not available.

Mobility in soil

- Soil/water partition coefficient (K_{oc})** : Not available.




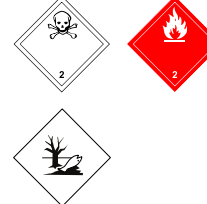

- Other adverse effects** : No known significant effects or critical hazards.

Section 13. Disposal considerations

Disposal methods

: The generation of waste should be avoided or minimized wherever possible. Disposal of this product, solutions and any by-products should at all times comply with the requirements of environmental protection and waste disposal legislation and any regional local authority requirements. Dispose of surplus and non-recyclable products via a licensed waste disposal contractor. Waste should not be disposed of untreated to the sewer unless fully compliant with the requirements of all authorities with jurisdiction. Empty Airgas-owned pressure vessels should be returned to Airgas. Waste packaging should be recycled. Incineration or landfill should only be considered when recycling is not feasible. This material and its container must be disposed of in a safe way. Empty containers or liners may retain some product residues. Do not puncture or incinerate container.

Section 14. Transport information

	DOT	TDG	Mexico	IMDG	IATA
UN number	UN3522	UN3522	UN3522	UN3522	UN3522
UN proper shipping name	Arsine, absorbed	Arsine, absorbed	Arsine, absorbed	Arsine, absorbed	Arsine, absorbed
Transport hazard class(es)	2.3 (2.1) 	2.3 (2.1) 	2.3 (2.1) 	2.3 (2.1) 	2.3 (2.1) 
Packing group	-	-	-	-	-
Environment	No.	No.	No.	Yes.	No.
Additional information	Toxic - Inhalation hazard Zone A Limited quantity Yes. Packaging instruction Passenger aircraft Quantity limitation: Forbidden. Cargo aircraft Quantity limitation: Forbidden. Special provisions 1	Product classified as per the following sections of the Transportation of Dangerous Goods Regulations: 2.13-2.17 (Class 2), 2.13-2.17 (Class 2), 2.7 (Marine pollutant mark). The marine pollutant mark is not required when transported by road or rail. Explosive Limit and Limited Quantity Index 0 ERAP Index 0 Passenger Carrying Ship Index Forbidden Passenger Carrying Road or Rail Index Forbidden Special provisions 38	-	The marine pollutant mark is not required when transported in sizes of ≤5 L or ≤5 kg.	The environmentally hazardous substance mark may appear if required by other transportation regulations. Passenger and Cargo Aircraft Quantity limitation: 0 Forbidden Cargo Aircraft Only Quantity limitation: 0 Forbidden

“Refer to CFR 49 (or authority having jurisdiction) to determine the information required for shipment of the product.”

Section 14. Transport information

Special precautions for user : **Transport within user's premises:** always transport in closed containers that are upright and secure. Ensure that persons transporting the product know what to do in the event of an accident or spillage.

Transport in bulk according to Annex II of MARPOL 73/78 and the IBC Code : Not available.

Section 15. Regulatory information

U.S. Federal regulations : **TSCA 8(a) CDR Exempt/Partial exemption:** Not determined
United States inventory (TSCA 8b): This material is listed or exempted.
Clean Water Act (CWA) 307: Arsine, absorbed

Clean Air Act (CAA) 112 regulated toxic substances: Arsine, absorbed

Clean Air Act Section 112 (b) Hazardous Air Pollutants (HAPs) : Listed

Clean Air Act Section 602 Class I Substances : Not listed

Clean Air Act Section 602 Class II Substances : Not listed

DEA List I Chemicals (Precursor Chemicals) : Not listed

DEA List II Chemicals (Essential Chemicals) : Not listed

SARA 302/304

Composition/information on ingredients

Name	%	EHS	SARA 302 TPQ		SARA 304 RQ	
			(lbs)	(gallons)	(lbs)	(gallons)
Arsine, absorbed	100	Yes.	100	-	100	-

SARA 304 RQ : 100 lbs / 45.4 kg

SARA 311/312

Classification : Refer to Section 2: Hazards Identification of this SDS for classification of substance.

SARA 313

	Product name	CAS number	%
Form R - Reporting requirements	Arsine, absorbed	7784-42-1	100
Supplier notification	Arsine, absorbed	7784-42-1	100

SARA 313 notifications must not be detached from the SDS and any copying and redistribution of the SDS shall include copying and redistribution of the notice attached to copies of the SDS subsequently redistributed.

State regulations

Massachusetts : This material is listed.

New York : This material is listed.

New Jersey : This material is listed.

Pennsylvania : This material is listed.

California Prop. 65

WARNING: This product contains a chemical known to the State of California to cause cancer.

Section 15. Regulatory information

Ingredient name	Cancer	Reproductive	No significant risk level	Maximum acceptable dosage level
Arsine, absorbed	Yes.	No.	0.06 µg/day (inhalation)	No.

International regulations

International lists

National inventory

Australia	: This material is listed or exempted.
Canada	: This material is listed or exempted.
China	: This material is listed or exempted.
Europe	: This material is listed or exempted.
Japan	: This material is listed or exempted.
Malaysia	: Not determined.
New Zealand	: This material is listed or exempted.
Philippines	: This material is listed or exempted.
Republic of Korea	: This material is listed or exempted.
Taiwan	: This material is listed or exempted.

Canada

WHMIS (Canada)	: Class A: Compressed gas. Class B-1: Flammable gas. Class D-1A: Material causing immediate and serious toxic effects (Very toxic). Class D-2A: Material causing other toxic effects (Very toxic). CEPA Toxic substances: This material is listed. Canadian ARET: This material is not listed. Canadian NPRI: This material is listed. Alberta Designated Substances: This material is not listed. Ontario Designated Substances: This material is not listed. Quebec Designated Substances: This material is not listed.
-----------------------	--

Section 16. Other information

Canada Label requirements	: Class A: Compressed gas. Class B-1: Flammable gas. Class D-1A: Material causing immediate and serious toxic effects (Very toxic). Class D-2A: Material causing other toxic effects (Very toxic).
----------------------------------	---

Hazardous Material Information System (U.S.A.)

Health	*	4
Flammability		4
Physical hazards		2

Caution: HMIS® ratings are based on a 0-4 rating scale, with 0 representing minimal hazards or risks, and 4 representing significant hazards or risks. Although HMIS® ratings are not required on SDSs under 29 CFR 1910.1200, the preparer may choose to provide them. HMIS® ratings are to be used with a fully implemented HMIS® program. HMIS® is a registered mark of the National Paint & Coatings Association (NPCA). HMIS® materials may be purchased exclusively from J. J. Keller (800) 327-6868.

The customer is responsible for determining the PPE code for this material.

National Fire Protection Association (U.S.A.)

Section 16. Other information



Reprinted with permission from NFPA 704-2001, Identification of the Hazards of Materials for Emergency Response Copyright ©1997, National Fire Protection Association, Quincy, MA 02269. This reprinted material is not the complete and official position of the National Fire Protection Association, on the referenced subject which is represented only by the standard in its entirety.

Copyright ©2001, National Fire Protection Association, Quincy, MA 02269. This warning system is intended to be interpreted and applied only by properly trained individuals to identify fire, health and reactivity hazards of chemicals. The user is referred to certain limited number of chemicals with recommended classifications in NFPA 49 and NFPA 325, which would be used as a guideline only. Whether the chemicals are classified by NFPA or not, anyone using the 704 systems to classify chemicals does so at their own risk.

Procedure used to derive the classification

Classification	Justification
Flam. Gas 1, H220 Press. Gas Comp. Gas, H280 Acute Tox. 1, H330 Carc. 1A, H350 STOT SE 1, H370 STOT RE 1, H372 Aquatic Acute 1, H400 Aquatic Chronic 1, H410	Expert judgment According to package On basis of test data Expert judgment Expert judgment Expert judgment Expert judgment Expert judgment

History

Date of printing : 7/20/2017

Date of issue/Date of revision : 7/20/2017

Date of previous issue : No previous validation

Version : 1

Key to abbreviations

: ATE = Acute Toxicity Estimate
BCF = Bioconcentration Factor
GHS = Globally Harmonized System of Classification and Labelling of Chemicals
IATA = International Air Transport Association
IBC = Intermediate Bulk Container
IMDG = International Maritime Dangerous Goods
LogPow = logarithm of the octanol/water partition coefficient
MARPOL 73/78 = International Convention for the Prevention of Pollution From Ships, 1973 as modified by the Protocol of 1978. ("Marpol" = marine pollution)
UN = United Nations

References : Not available.

☑ Indicates information that has changed from previously issued version.

Notice to reader

To the best of our knowledge, the information contained herein is accurate. However, neither the above-named supplier, nor any of its subsidiaries, assumes any liability whatsoever for the accuracy or completeness of the information contained herein.

Final determination of suitability of any material is the sole responsibility of the user. All materials may present unknown hazards and should be used with caution. Although certain hazards are described herein, we cannot guarantee that these are the only hazards that exist.